



Pipeline Safety Division Investigation Report

Investigation regarding: **Indiana Underground Construction**

UPPAC Database Record ID: 3533

Investigator: Howard Friend

Report Date: 10/25/2012

Damage Date: 8/1/2012 10:45:40 AM

Damage Address: 895 South Sr 135

City: Greenwood

County: Johnson

The Parties

Excavator: **Indiana Underground Construction**

Contact: Randy Downing

Address: 3034 North Ritter Avenue, Indianapolis, In 46218

Telephone: (317) 545-6161

Facility Owner: Vectren

Contact: Darlene Kulhanek

Address: 1 N Main Street, Evansville, IN 47702

Pipeline Facility

Facility Type: Natural Gas

Facility Function: Service/Drop

Investigation regarding: Indiana Underground Construction

UPPAC Database Record ID: 3533

Damage Impact

Product release: Yes

Ignition: No

Service Interruption: True

Number of Customers Affected: 1

Injuries: 0

Fatalities: 0

Repair Cost (if known): \$4058

Excavator Activities/Cause of damage information:

Excavator request locates: Yes Indiana 811 ticket Number: 1207201666

Type of Equipment: Boring

Type of work performed: Telecommunications

Synopsis: A natural gas service was damaged during a boring procedure to install fiber optic conduit.

Findings: Excavator was working under a valid, accurately marked locate request but failed to expose the main to verify location and depth prior to beginning directional drilling procedure. Reported by Indiana 811; excavator signed for initial notice on 09/17/2012 but has not submitted a response.

Conclusion: Excavator failed to maintain the required clearance with mechanized equipment.

Violation: IC 8-1-26-20(b): Failure to plan excavation to avoid damage or interference with underground facilities; Failure to maintain two (2) feet clearance with mechanized equipment.



Date: 09/17/2012

MAIL MAIL:

The following is in response to your 09/17/2012 request for delivery information on your Certified Mail(TM)/RRE item number 9214 8901 0661 5400 0004 2833 37. The delivery record shows that this item was delivered on 09/17/2012 at 08:55 AM in INDIANAPOLIS, IN 46218. The scanned image of the recipient information is provided below.

Signature of Recipient:

| Delivery Section | |
|------------------|------------------|
| Signature | |
| Name | CHARLIE HORTWELL |

Address of Recipient:

| | |
|---------|--|
| Address | |
|---------|--|

Thank you for selecting the Postal Service for your mailing needs. If you require additional assistance, please contact your local Post Office or postal representative.

Sincerely,

United States Postal Service

The customer reference info shown below is not validated or endorsed by the United States Postal Service. It is solely for customer use.

3533
RANDY DOWNING
INDIANA UNDERGROUND CONSTRUCTION
3034 N RITTER AVE
INDIANAPOLIS IN 46218-2501



INDIANA UTILITY REGULATORY COMMISSION
101 W. WASHINGTON STREET, SUITE 1500E
INDIANAPOLIS, INDIANA 46204-3407

<http://www.in.gov/iurc>
Office: (317) 232-2701
Facsimile: (317) 232-6758

September 18, 2012

Ms. Darlene Kulhanek
Vectren
1 N Main Street
Evansville, IN 47702

Subject: Investigation Request for Information

Date of Event: 8/1/2012

Event Location: / In Rt 135 /, Greenwood

Facility Owner: Vectren

Excavator: Indiana Underground Construction

Other Party: N/A

Pipeline Division Case No. 3533

Dear Ms. Kulhanek:

Pursuant to Indiana Code 8-1-26, the *Indiana Damage to Underground Facilities Act*, the Pipeline Safety Division of the Indiana Utility Regulatory Commission ("Pipeline Division") is required to investigate reported incidents of alleged statutory violations involving underground pipeline safety. The purpose of this statute is to promote excavation and pipeline safety and to reduce the imminent danger to life, health, property, or loss of service associated with unsafe digging practices. Please note that the investigation does not entail determining criminal liability or a civil determination of fault or damages; however, it does determine whether any statutory violations were committed regarding public safety.

The Pipeline Division received information regarding potential statutory violations regarding the date and location referenced above. You were identified as a person or entity that might have information that would assist the Pipeline Division in its investigation. Therefore, we have contacted you in order to receive the full account of information in order to make a fair determination related to the circumstances of this incident.

We have asked all involved parties, entities and witnesses to provide *written* information within *30 days* in order to meet legal deadlines to conclude our investigation. **Please consider this letter as a formal request to receive any and all information and evidence (including a narrative, documentation, maps, photographs or any other written information) you can access regarding anything you may know about the incident referenced above.**



DAMAGE INFORMATION REPORT – PIPELINE SAFETY DIVISION

State Form 54122 (R2 / 7-11)
INDIANA UTILITY REGULATORY COMMISSION

Submitted to IURC-Pipeline Safety on: 10-5-2012

Who is submitting this information?

Name of person providing this information: Darlene Kulhanek

Business address (*number and street*): 1 Main Street

City, State, and ZIP code: Evansville, IN 47711

Telephone number (*area code*): 812-491-4227

Fax number (*area code*): 812-491-4504

E-mail address: dkulhanek@vectren.com

Excavator Information, if known

Full name: Indiana Underground Construction Inc.

Business address (*number and street*): 4851 E 23rd Street

City, State, and ZIP code: Indianapolis, IN 46218

Telephone number (*area code*): 317-545-6161

Fax number (*area code*): 317-545-6166

E-mail address: Unknown

Excavation or Demolition Information

Excavator type: Contractor

Excavation or demolition equipment: Boring

Type of work performed: Telecommunications

Date and Location of Damage

Date of damage (*month, day, year*): 8-1-2012

County: Johnson

City: Greenwood

Street address (*number and street, city, state, and ZIP code*):
895 S State Rd 135, Greenwood, IN

Nearest intersection: Unknown

Right of way where damage occurred: Public - City Street

Was there a release of product? Yes

If yes, was there an ignition of product? No

Were evacuations necessary as a result of release? No

If yes, how many evacuated? 0

Was there a customer service interruption? Yes

If yes, how many affected? 1

Time to restore service (*in hours*): 4.5

Enter number of injuries, if applicable and known: 0

Enter number of fatalities, if applicable and known: 0

Property damage, Estimate \$ 4,057.57

Affected Facility Information

What type of pipeline was damaged? Natural Gas

What was the affected facility? Service/Drop

What was the depth of the facility, in inches? _____

Notification, Locating, Marking

Did excavator request locates prior to commencing work? Yes

Enter Indiana 811 ticket number, if known: 1207201666

Was the locate request completed within two working days? Yes

If locates were performed, were they done so by a contractor or pipeline employee? Contract Locator

If a contractor locator, enter the company name, if known: USIC

Were facility marks visible in the area of excavation? Yes

Were facilities marked correctly? Yes

Type of markings used: Paint

If other, please specify: Unknown

Was site marked by "White Lining"? Yes

Were special instructions part of the locate request? Unknown/Other

Were maps used to complete the locate request? Unknown/Other

Were pipeline company representatives on site during excavation? No

Did the excavator notify the operator in the event of this damage? No

Did the excavator notify Indiana 811 in the event of this damage? Yes

Did the excavator notify 911 in the event of a release of product? Unknown/Other

Description of Cause

Select from the list the most accurate cause for the damage: --Failure to use hand tools where required

Additional Comments

2" plastic service damaged by bore. Not hand exposed.




2 VECTREN ENERGY DELIVERY OF INDIANA - NORTH

NOW DUE
FINAL
\$4,057.57

INDIANA UNDERGROUND CONSTRUCTION INC
4851 E 23RD ST,
INDIANAPOLIS, IN 46218

Type: GAS
Invoice: FDS0016656
BillToID: 32308
Billing Date: 9/6/2012
Date of Loss: 8/1/2012
5835 103.0510

Please return this portion with your remittance.

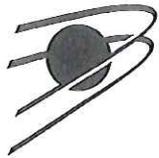

Mail Payment To:
Vectren Utilities Holding Group, Inc.
1239 Reliable Parkway
Chicago, IL 60686-0012
Inquiries: 1-877-902-2934, Mon.-Fri., 8-5
Risk Management/Claims Department

INDIANA UNDERGROUND CONSTRUCTION INC
4851 E 23RD ST,
INDIANAPOLIS, IN 46218

Type: GAS
Invoice: FDS0016656
BillToID: 32308
Billing Date: 9/6/2012
Date of Loss: 8/1/2012

NOW DUE
FINAL
\$4,057.57

Invoice For Costs to Repair and Reconstruct Damaged Property

Address: 895 S STATE RD 135, GREENWOOD
2" PLASTIC SERVICE DAMAGED BY BORE. NOT HAND EXPOSED.

| | |
|---------------------------|-------------------|
| Material: | \$371.46 |
| Company Labor: | \$2,865.73 |
| Contract Labor: | \$0.00 |
| Transportation/Equipment: | \$383.93 |
| Misc: | \$0.00 |
| Gas Loss: | \$436.45 |
| Adjustments: | \$0.00 |
| Payments: | \$0.00 |
| Total: | \$4,057.57 |

5835 103.0510

Remember, call two (2) working days before digging. Contact I.U.P.P.S. at 1-800-382-5544.

Vectren Claim Number: _____

FDS 0016656

Task No: 103.0510 Capital / O & M (circle one)

Police Report / MO #: _____

Date of Damage 8 / 1 / 12

Cost Center # 5835

Time Occurred 10:40 am / pm

Time Found 10 am / pm

Latitude 39.603900 Longitude: -86.159130 GAS

DAMAGE SITE: Address 895 S. State Road 135 Lot # _____

County Johnson City Greenwood State IN Township _____

Vectren Claims Camera:

VE02124
3

| FACILITIES DAMAGED: | ORIFICE SIZE(S): | (1) | (2) | (3) |
|--|------------------|-------------------------------------|--------------------------|--------------------------|
| <input type="checkbox"/> Farm Tap | 0.50 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Heater | 5/8 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Main | 0.75 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Meter (Residential) | 1.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Meter (Industrial / Commercial) | 1.25 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Odorizer | 2.00 inch | <input checked="" type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Regulator Station | 3.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Relief Valve | 4.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Riser | 5.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input checked="" type="checkbox"/> Service Line | 6.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Valve | 10.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| | 12.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| | 16.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| | 20.00 inch | <input type="checkbox"/> | <input type="checkbox"/> | <input type="checkbox"/> |
| <input type="checkbox"/> Other _____ | Other | | | |

2.185

| TYPE OF MATERIAL: | DAMAGE TYPE: | PRESSURE: |
|--|----------------------------------|---|
| <input type="checkbox"/> Cast Iron | <input type="checkbox"/> Severed | <input type="checkbox"/> 25 PSIG |
| <input type="checkbox"/> Plastic (HDPE) | <input type="checkbox"/> Not Cut | <input type="checkbox"/> 40 PSIG |
| <input checked="" type="checkbox"/> Plastic (MDPE) | <input type="checkbox"/> Severed | <input type="checkbox"/> 50 PSIG |
| <input type="checkbox"/> Steel | Size <u>3/4" x 5"</u> | <input type="checkbox"/> 55 PSIG |
| | | <input checked="" type="checkbox"/> 60 PSIG |
| <input type="checkbox"/> Other _____ | | <input type="checkbox"/> 6 WC (.2163) |
| | | <input type="checkbox"/> 7 WC (252) |
| | | <input type="checkbox"/> Other _____ |

48.4/6

PROTECTION IN PLACE:
 Building Fence None
 Post Rail Vault N/A
 Other _____

DURATION OF ESCAPING GAS: 94 min
Minutes: 10:40 - 12:14

LEAK REPORT NUMBER: N/A

EFV Activated Yes No N/S

FEED TYPE:
 One-Way Feed
 Two-Way Feed

Number of Customers Affected: 1
Total Hours Service Was Off: 4 1/2 HRS.

SERVICE ORDER NUMBER: N5326138

DAMAGED BY:
 Company Crew
 Contractor
 County
 Developer
 Farmer
 Municipality
 Property Owner/ Tenant
 Railroad
 State
 Unknown
 Utility
 Vehicle Accident
 Other _____

TYPE OF CONSTRUCTION:
 Agriculture
 Building Construction
 Building Demolition
 Cable TV
 Curbs / Sidewalk
 Drainage
 Driveway
 Electric
 Engineering / Surveying
 Fencing
 Grading
 Irrigation
 Landscaping
 Liquid Pipeline
 Milling
 Pole
 Natural Gas
 Public Transit Authority
 Railroad Maintenance
 Other Fibre Optic Conduit

WORKING FOR:
 City County Developer
 State Property Owner
 Utility

VISUAL OBSERVATION AT DAMAGE SITE: 8/2
Visual Observation: Above Ground Below Ground
Locate Applicable Yes No N/S
Facilities Properly Marked Yes No N/S
Marking Methods: Conventional Flags None Whiskers
 Offset Paint Stakes
Locate Marking Faded: Yes No N/S
Wrong Address Requested Yes No N/S

Facilities Improperly Located:
 Qualified Locator Could Not Have Accurately Located
 Inaccurate Maps / Cards
 Broken or No Tracer Wire (Plastic) N/A
 Insulation Preventing Accurate Locate

Locator Error:
 Failure to Follow Policy
 Inappropriate Site Markings N/A
 Incomplete Locate
 No Locates Performed
 Qualified Locator Could Have Accurately Located
 Wrong Address Located
 Marking Off By: _____ (Feet / Inches)

Were Facility Marks Visible Yes No Destroyed
Was Area White Lined Yes No Destroyed
Positive Response Yes No Destroyed
Tolerance Zone Violated Yes No
Part of Project Yes No
Company Representative On-Site Yes No

Observation by (ID#): 2524

Name of Locator: Matt

LOCATING ORGANIZATION:
 Contract Locator
 Unknown / Other
 Utility Owner

NOTIFICATIONS AND OTHER DETAILS OF LOCATE:

Locate Ticket: 1207201666

Date: _____ Time: _____ am / pm

TYPE OF REQUEST:

Regular Request Emergency Request
 Locate Company Notified
Contact Name: _____
Time Called: _____ am / pm
Time Locator Arrived at the Site: _____ am / pm

Company Notified of Locate Near Critical Facilities
 Yes No N/S

Copy of Mark Out Request Provided Within 2 Working Days
 Yes No N/S

ONE-CALL CENTER:

TUPPS
 OUPS
 Unknown

AUG 7 2012

Vectren Claim Number: _____

TYPE OF EQUIPMENT:

- Auger
- Backhoe / Track hoe
- Boring
- Drilling
- Explosives
- Farm Equipment
- Grader / Scraper
- Hand Tools
- Milling Equipment
- Plow
- Probing Device
- Trencher
- Vacuum Equipment
- Vehicle
- Other _____

ROOT DAMAGING CAUSE:

- Abandoned Facility
- Deteriorated Facility
- Facility Could Not be Found/ Located
- Facility Was Not Located / Marked
- Failure to Maintain Clearance
- Failure to Maintain Marks
- Failure to Support Exposed Facility
- Failure to Use Hand Tools Where Required
- Improper Backfilling
- Incorrect Records / Maps
- Marking or Location Not Sufficient
- No Notification Made to One-Call
- One-Call Notification Error
- Previous Damage
- Wrong Information Provided
- Other _____

CONTRACTOR REPAIRS:

- Contractor Working for Vectren Made Repairs at Own Expense
 Yes No N/S
- Contractor Repaired Damage
 Yes No N/S

Name of Contractor: N/A
 # of Regular Hours; _____
 # of Overtime Hours; _____
 # of Regular Hours; _____
 Crew Type: _____

MATERIALS OR ROAD WORK:

- Meter was replaced _____ (Stores Code)
- Regulator Was Replaced _____ (Stores Code)
- Temporary Asphalt Repair: 54 (sq. ft.)
- Permanent Asphalt Repair: _____ (sq. ft.)

RIGHT OF WAY:

- Dedicated Utility Easement
- Federal Utility Easement
- Pipeline
- Power / Transmission Line
- Private - Business
- Private - Easement
- Private - Land Owner
- Public - County Road
- Public - Interstate Highway
- Public - Other
- Public - State Highway
- Public - City Street
- Unknown

- Did Excavator Notify You Yes No
- Excavation Required Yes No
- Media at Site Yes No
- Was There Ignition of Gas? Yes No
- INVOICE: Yes No N/S

DAMAGING PARTY: Randy Downing
 Name: Indiana Underground Constr.
 Address: 4851 E 23 Rd St.
 City/ State/ Zip: Indpls, IN. 46218
 Phone: (317) 545 6161
 Prepared / Investigated By: Kevin VanSlyke Date: 8/1/12

PARTY TO INVOICE:
 Name: Same as damaging party
 Address: _____
 City/ State/ Zip: _____
 Phone: _____
 Reviewed by Field Supervisor: [Signature] Date: 8-2-12

Contractor did not spot this line before boring across it. Contractor is at fault.

NORMAL NOTICE

Ticket : 1207201666 Date: 07/20/2012 Time: 13:59 Oper: ASCHLICHTER Chan:042

State: IN Cnty: JOHNSON Twp: WHITE RIVER
 Cityname: GREENWOOD Inside: N Near: Y
 Subdivision:

Address :
 Street : IN RT 135
 Cross 1 : STELLA DR Within 1/4 mile: Y
 Location: FROM THE ABOVE INTERSECTION TRAVEL SOUTH ALONG THE WEST SIDE OF IN RT 135 FOR APPROX 85 FEET - THEN LOCATE GOING EAST ACROSS IN RT 135 - APPROX 100 FEET - THEN TURN NORTH LOCATING ALONG THE EAST SIDE OF IN RT 135 FOR APPROX 1750 FEET TO SECOND TARGET ENTRANCE - TRENCH ROUTE MARKED WITH WHITE PAINT AND FLAGS
 ***Boring Where = UNDER ENTIRE JOB

Grids : 3935A8609B 3936D8609B 3936C8609B

Work type : PLACING FIBER CABLE
 Done for : INDIANA FIBER NETWORK
 Start date: 07/24/2012 Time: 14:15 Hours notice: 96/048 Priority: NORM
 Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: N
 Duration : 4 DAYS Depth: 48 INCHES

Company : INDIANA UNDERGROUND CONSTRUCTION Type: CONT
 Co addr : 3034 NORTH RITTER AVENUE
 City : INDIANAPOLIS State: IN Zip: 46218
 Caller : JIM SCHULTHIES Phone: (317)545-6126
 Contact : JIM SCHULTHIES - CELL Phone:
 BestTime:
 Mobile : (317)443-9007
 Fax : (317)545-6166

Remarks : All tickets are taken and processed on Eastern Daylight Time
 Will you be white-lining the dig site area? YES

Submitted date: 07/20/2012 Time: 13:59
 Members: ID0002 ID0270 ID1254 ID3734 ID4752 ID4866 ID7053 ID7131 ID7288 SBCIN
 SM

| Member Name | Facility Types |
|--|-------------------------|
| AT&T - DISTRIBUTION | COMMUNICATIONS |
| AT&T - TRANSMISSION | FIBER OPTIC |
| BARGERSVILLE, TOWN OF | ELECTRIC, SEWER & WATER |
| COMCAST CENTRAL (GREENWOOD) | CABLE TV |
| DUKE ENERGY / FORMERLY CINERGY | ELECTRIC |
| GREENWOOD, CITY OF | |
| IN AMERICAN WATER JOHNSON COUNTY WATER | |
| VECTREN - FRANKLIN | GAS |
| WINDSTREAM KDL | COMMUNICATIONS |
| ZAYO BANDWIDTH | FIBER OPTIC |

[View Map](#)

[Close Map](#)

SECOND NOTICE 2ND NOTICE

Ticket : 1207201666 Date: 07/30/2012 Time: 10:48 Oper: SPEOPLES Chan:036
 Old Tkt: 1207201666 Date: 07/20/2012 Time: 13:59 Oper: ASCHLICHTER Rev: 00A

State: IN Cnty: JOHNSON Twp: WHITE RIVER
 Cityname: GREENWOOD Inside: N Near: Y
 Subdivision:

Address :
 Street : IN RT 135
 Cross 1 : STELLA DR Within 1/4 mile: Y
 Location: FROM THE ABOVE INTERSECTION TRAVEL SOUTH ALONG THE WEST SIDE OF IN RT 135 FOR APPROX 85 FEET - THEN LOCATE GOING EAST ACROSS IN RT 135 - APPROX 100 FEET - THEN TURN NORTH LOCATING ALONG THE EAST SIDE OF IN RT 135 FOR APPROX 1750 FEET TO SECOND TARGET ENTRANCE - TRENCH ROUTE MARKED WITH WHITE PAINT AND FLAGS
 ***Boring Where = UNDER ENTIRE JOB

:
 Grids : 3935A8609B 3936D8609B 3936C8609B

Work type : PLACING FIBER CABLE
 Done for : INDIANA FIBER NETWORK
 Start date: 07/24/2012 Time: 14:15 Hours notice: 0/000 Priority: NORM
 Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: N
 Duration : 4 DAYS Depth: 48 INCHES

Company : INDIANA UNDERGROUND CONSTRUCTION Type: CONT
 Co addr : 3034 NORTH RITTER AVENUE
 City : INDIANAPOLIS State: IN Zip: 46218
 Caller : JIM SCHULTHIES Phone: (317)545-6126
 Contact : JIM SCHULTHIES - CELL Phone:
 BestTime:
 Mobile : (317)443-9007
 Fax : (317)545-6166

Remarks : All tickets are taken and processed on Eastern Daylight Time
 PER TERRY - STILL NEED ALL UTILITIES TO RESPOND TO THIS TICKET ASAP - THANK YOU
 Will you be white-lining the dig site area? YES

:
 Submitted date: 07/30/2012 Time: 10:48
 Members: ID0002 ID0270 ID1254 ID3734 ID4752 ID4866 ID7053 ID7131 ID7288 SBCIN
 SM

| Member Name | Facility Types |
|--|-------------------------|
| AT&T - DISTRIBUTION | COMMUNICATIONS |
| AT&T - TRANSMISSION | FIBER OPTIC |
| BARGERSVILLE, TOWN OF | ELECTRIC, SEWER & WATER |
| COMCAST CENTRAL (GREENWOOD) | CABLE TV |
| DUKE ENERGY / FORMERLY CINERGY | ELECTRIC |
| GREENWOOD, CITY OF | |
| IN AMERICAN WATER JOHNSON COUNTY WATER | |
| VECTREN - FRANKLIN | GAS |
| WINDSTREAM KDL | COMMUNICATIONS |
| ZAYO BANDWIDTH | FIBER OPTIC |

[View Map](#)

[Close Map](#)

DAMAGE SEE REMARKS

Ticket : 1208011281 Date: 08/01/2012 Time: 10:44 Oper: SPOPE Chan:044

State: IN Cnty: JOHNSON Twp: WHITE RIVER
 Cityname: GREENWOOD Inside: N Near: Y
 Subdivision:

Address :
 Street : IN RT 135
 Cross 1 : STELLA DR Within 1/4 mile: Y
 Location: FROM THE ABOVE INTERSECTION TRAVEL SOUTH ALONG THE WEST SIDE OF IN RT 135 FOR APPROX 85 FEET - THEN LOCATE GOING EAST ACROSS IN RT 135 - APPROX 100 FEET - THEN TURN NORTH LOCATING ALONG THE EAST SIDE OF IN RT 135 FOR APPROX 1750 FEET TO SECOND TARGET ENTRANCE - TRENCH ROUTE MARKED WITH WHITE PAINT AND FLAGS
 ***Boring Where = UNDER ENTIRE JOB

Grids : 3935A8609B 3936D8609B 3936C8609B

Work type : PLACING FIBER CABLE
 Done for : INDIANA FIBER NETWORK
 Start date: 08/01/2012 Time: 10:44 Hours notice: 0/000 Priority: EMER
 Ug/Oh/Both: U Blasting: N Boring: Y Railroad: N Emergency: Y
 Duration : 4 DAYS Depth: 48 INCHES

Company : INDIANA UNDERGROUND CONSTRUCTION Type: CONT
 Co addr : 3034 NORTH RITTER AVENUE
 City : INDIANAPOLIS State: IN Zip: 46218
 Caller : RANDY DOWNING Phone: (317)545-6126
 Contact : RANDY DOWNING --- CELL Phone:
 BestTime:
 Mobile : (317)443-9961
 Fax : (317)545-6166

Remarks : All tickets are taken and processed on Eastern Daylight Time
 UNKNOWN GAS LINE HAS BEEN CUT--LINE IS BLOWING--911 ON SITE--LINE WAS CUT ALONG DRIVEWAY TO TARGET STORE--SIZE AND COLOR UNKNOWN--CREW ON SITE--PREV TICKET 1207201666--THANK YOU
 Will you be white-lining the dig site area? YES

Submitted date: 08/01/2012 Time: 10:44
 Members: ID0002 ID0270 ID1254 ID3734 ID4636 ID4752 ID4866 ID7053 ID7131 ID7288
 SBCIN SM

| Member Name | Facility Types |
|----------------------------------|-------------------------|
| AT&T - DISTRIBUTION | COMMUNICATIONS |
| AT&T - TRANSMISSION | FIBER OPTIC |
| BARGERSVILLE, TOWN OF | ELECTRIC, SEWER & WATER |
| COMCAST CENTRAL (GREENWOOD) | CABLE TV |
| DUKE ENERGY / FORMERLY CINERGY | ELECTRIC |
| GREENWOOD, CITY OF | |
| IN AMERICAN WATER JOHNSON COUNTY | WATER |
| INDIANA FIBER NETWORK, LLC | FIBER OPTIC |
| VECTREN - FRANKLIN | GAS |
| WINDSTREAM KDL | COMMUNICATIONS |
| ZAYO BANDWIDTH | FIBER OPTIC |

[View Map](#) | [Close Map](#)



Property of United States Infrastructure Corporation
Photo taken on 8/1/2012 12:17:46 PM



Property of United States Infrastructure Corporation
Photo taken on 8/1/2012 12:31:20 PM



Property of United States Infrastructure Corporation
Photo taken on 8/1/2012 12:22:28 PM



Property of United States Infrastructure Corporation
Photo taken on 8/1/2012 12:32:20 PM



Property of United States Infrastructure Corporation
Photo taken on 8/1/2012 5:57:34 PM

Service Order Status

Wednesday, August 8, 2012

Enter Service Order Number:

5326138



[View Form](#) | [Printer Job](#)

Banner Instance: CS03PROD CS01PROD CS02PROD

Order Number: N5326138

Order Type: LEAK

Order Status: Completed

Customer: 600365857 - TARGET STORES

Prem: 5500167 - 895 S STATE RD 135

Technician: 2524 - VanSlyke, Kevin

Order Dates and Times

Need Date: 8/1/2012 10:49:00 AM
Time Created: 8/1/2012 10:44:03 AM
Time Dispatched: 8/1/2012 10:44:04 AM
Time In Route: 8/1/2012 10:46:31 AM
Time On-Site: 8/1/2012 10:56:12 AM
Tech Complete: 8/1/2012 1:00:31 PM
Time Closed: 8/1/2012 1:00:31 PM

Events Performed/Completion Code

LKOT - CMP

Meter Information

Current Read Status

Old Meter: 54807 Inactive

New Meter:

Completion Notes

contractor cut 2" pl service under asphalt. fire dept on scene. I requested crew , monitored bldgs and assisted crew with making safe. crew will make repairs. le ft mtr s/o.

Request Notes

HIT LINE PER GREENWOOD FIRE DEPT. BY INDIANA UNDERGROUND CONSTR/RANDY DOWNING ON SITE 317 443 9961/FD CALL BACK 317-887-5200. AT 2ND ENTRANCETO TARGET STORE/XST: SELLA DR/LOCATE 1207201666/DAM # 12080 11281

MDSI Event Dates and Times

| Event | Date/Time | User |
|----------------------------|----------------------|-----------------|
| AsnAssignmentManualAck_evt | 8/1/2012 10:45:34 AM | VanSlyke, Kevin |
| AsnAssignmentEnRoute_evt | 8/1/2012 10:46:31 AM | VanSlyke, Kevin |
| AsnAssignmentOnSite_evt | 8/1/2012 10:56:12 AM | VanSlyke, Kevin |
| OrdOrderComplete_evt | 8/1/2012 1:00:31 PM | VanSlyke, Kevin |

NOTE: The Reporting database replicates in near real-time; it has been approximately 1 minute(s) since the last transaction replicated.